


Low Temperature Aluminum Brazing Rod

EutecRod[®] 190



- Perfect for high strength joining of aluminum tee and lap joints
- High strength fillet and bead joints on sheet, extruded and cast aluminum
- Excellent bridging properties for poor fit joints
- Aluminum joining without melting base metal

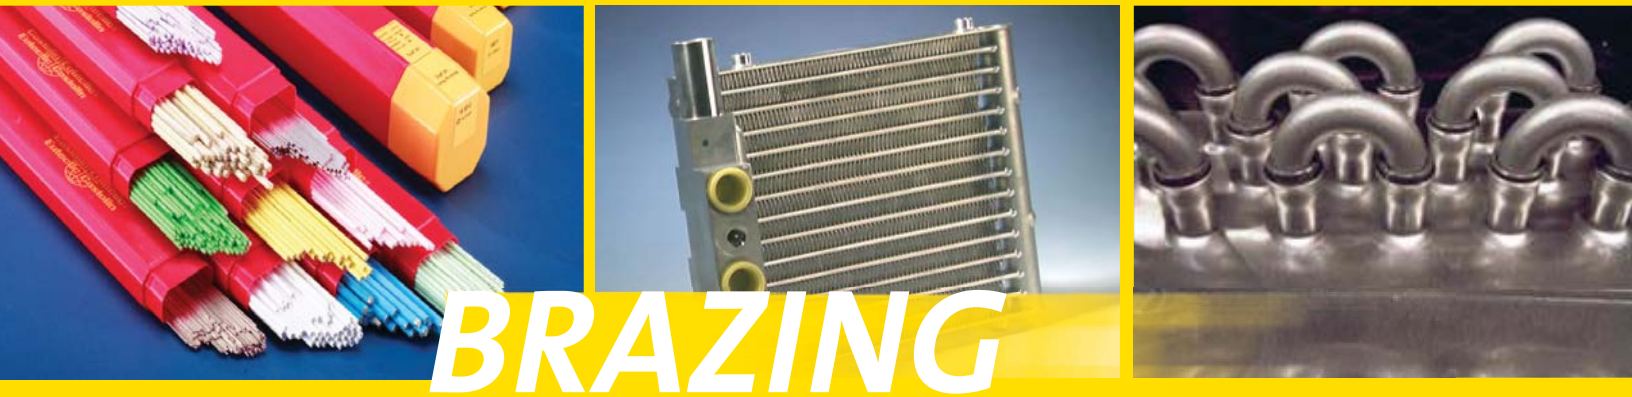

PRODUCT DESCRIPTION:

EutecRod 190 provides exceptional thin-flowing properties when oxy-fuel brazing sheet, tubing and most wrought forms of aluminum. Excellent color match with smooth, uniform fillets. Properties are highly compatible with aluminum grades 3xxx & 4xxx.

APPLICATIONS:

- Automotive and Bus Bodies
- Light-Gauge Truck Bodies
- Aluminum Housings
- Irrigation Piping
- Farming Implements
- Office Furniture
- Refrigeration Equipment
- Air-Conditioning Equipment

TECHNICAL DATA:

Physical and Mechanical Properties:

Typical Tensile Shear Strength: 34,000 psi (234 N/mm²)
Electrical Conductivity IACS: 42%
Solidus Temperature: 1070°F (575°C)
Liquidus Temperature: 1080°F (580°C)
Max. Brazing Temperature: 1120°F (605°C)
Heating Methods: Oxy-fuel, resistance, induction
Color Match Properties: Similar to wrought aluminum
(will darken if anodized)

PROCEDURE:

PREPARATION: Clean joint area and lightly abrade using a stainless steel wire brush or wire wool. For best results a slight gap of between .005" and .010" is recommended. No preheat is necessary with thin gauge material. For thicknesses up to 1/8" a nominal broad preheat of 200°F is suggested. *EutecTor*® 190 flux can be applied to the joint by making a paste with a small amount of water or alcohol.

Note: *EutecRod 190 requires the use of EutecTor® 190 flux.*

TECHNIQUE: Adjust the oxy-fuel flame so that it is slightly reducing or carburizing. Keep the torch moving rapidly to prevent localized overheating with the inner flame cone 1" to 2" from the joint. When the flux becomes molten apply the brazing alloy at equal points along the joint seam. Cool slowly.

POST-BRAZING: Remove flux, scrubbing in hot water and rinse. Note: It is mandatory to remove all traces of flux residues. If these are not removed they will cause corrosion.

YOUR RESOURCE FOR PROTECTION, REPAIR AND JOINING SOLUTIONS



Eutectic Corporation
N94 W14355 Garwin Mace Drive
Menomonee Falls, WI 53051 USA
P 800-558-8524 • F 262-255-5542
www.eutectic.com

Eutectic Services
12300 Carmen Avenue
Milwaukee, WI 53225 USA
P 800-558-8524 • F 262-255-5542



Statement of Liability: Due to variations inherent in specific applications, the technical information contained herein, including any information as to suggested product applications or results, is presented without representation or warranty, expressed or implied. Without limitation, there are no warranties of merchantability or of fitness for a particular purpose. Each process and application must be fully evaluated by the user in all respects, including suitability, compliance with applicable law and non-infringement of the rights of others, and Eutectic Corporation and its affiliates shall have no liability in respect thereof.

190 07-15 © 2008, Eutectic Corporation, © Reg. T.M., Printed in the U.S.A.